

1-3

VIDX
HINDAN


IAF
24 OCT 25

HINDAN, INDIA
CAT II ILS RWY 27


HINDAN Tower 130.1, VC		HINDAN Approach 134.2, UC, VC		ATIS 113.4		2600' MSA HND VOR
VOR HND 113.4	ILS IHND 111.7	FINAL Apch Crs 269°	FAP D 4.7 IHND 2200'	DA (H) As per table	Apt Elev 703' RWY 701'	
MISSED APCH: Climb Straight ahead to 1500', Turn RIGHT hdg 320° Climb to 2600', turn RIGHT to join VOR hold at 2600' or as directed by ATC.						
Alt Set: hPa		Rwy Elev: 25 hPa	Trans level: By ATC	Trans alt: 5000'		

DME Required

1 Inch = 7.5 NM
7.5 NM
0
7.5 NM

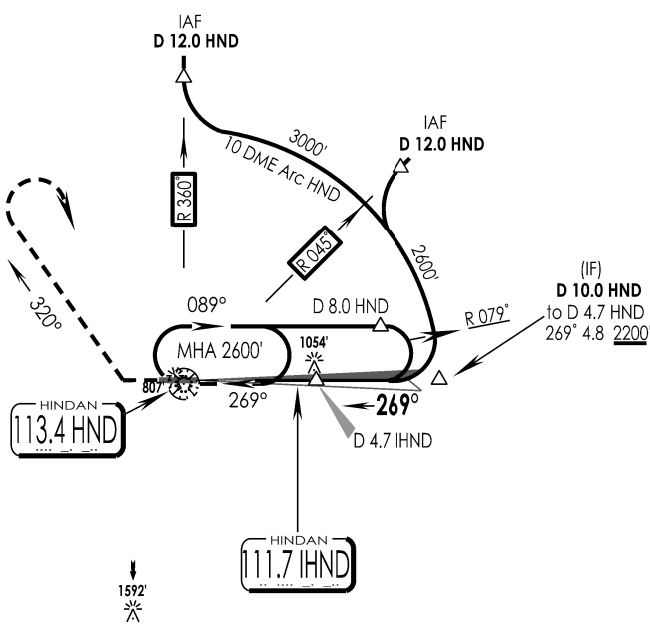

- 1. Holding and initial approach speeds restricted to max 220 KTS IAS.
- 2. Avoid crossing south of R-072 DPN.

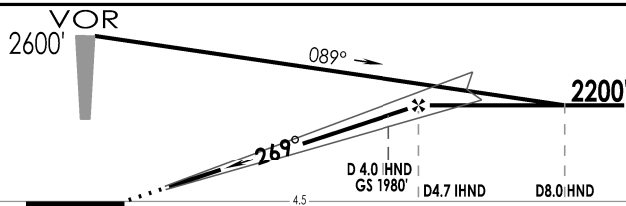

GND SPEED KTS	80	100	120	140	160	180	↑ 1500'	 320°	↑ 2600'
ILS GS or LOC DESCENT ANGLE 3°	425	531	637	743	849	955			
STRAIGHT-IN LANDING RWY 27									
ILS CAT II									
DA (H)	AB: 814' (113')		CD: 840' (139')		RA		AB: 113'		CD: 139'
FULL									
A	RVR 300m								
B									
C	RVR 400m								
D									

CHANGES : NONE IPDC, DTE OF OPS (T & H)

SURVEY PERIOD : 2021-22 & 2023-24